

Illusion Full grain

Vår populära Illusion has outökats with a collection that has a clearer narv. Very hög kvalitet för krävande miljöer. Meets most requirements of the market.

Illusion Full Grain säljs på avmätning or in roll of 30 m.

Uses:

Cladding decoration, Boat & caravan cladding , Furniture upholstery public environment, Furniture lining, Upholstery marine environment
IMO


Width:	140 ± 1 cm	Flexing resistance:	50000 (ISO 5402-1)
Composition:	100% PU	Tensile strength Warp:	506 N/5cm (ISO 1421)
Composition backing:	100% Cotton	Tensile strength Weft:	347 N/5cm (ISO 1421)
Weight (g/m ²):	595 ± 30 g/m ²	Tear Strength weft:	58 N (ISO 4674-1)
Thickness (mm):	1 mm ± 0,1 mm	Tear strength warp:	56 N (ISO 4674-1)
Roll length (m):	30	Seam slippage Warp:	200 N (ISO 13936-1)
Fire test:	Cal TB 117,BS 5852 Crib 5,DIN 4102 B2,EN 1021-1 & 2,FMVSS 302,IMO 2010 FTP Code part 8	Seam slippage Weft:	200 N (ISO 13936-1)
Öko-Tex Certifikatnummer:	1202005	Biocompatibility:	(ISO 10993-10)
Martindale:	500000 (ISO 5470-2)	Tropical test:	10 Weeks (ISO 1419)
Colour fastness to rubbing - dry:	4-5 (ISO 105-X12)	Cold cracking resistance:	-40°C (EN 1876-1)
Colour fastness to rubbing - wet:	4-5 (ISO 105-X12)	Adhesion - surface finish Warp:	35,8 N/5cm (ISO 2411)
Color Fastness To Light:	≥ 7 (ISO 105-B02)	Adhesion - surface finish Weft:	28,9 N/5cm (ISO 2411)

The product shall be cleaned with lukewarm PH-neutral soapy water and a soft cloth or soft brush. And should be wiped with a damp cloth afterwards. Do not use solvents or chemical cleaners, but cleaning can be done with alcohol-based cleaners. Wipe with a damp cloth. Any stains from ink, wine, coffee, oil, grease and coloring pigments from textiles must be removed immediately.

Please note that Nevotex does not accept complaints due to substandard maintenance or dry folding from jeans and other textiles.

5 YEAR PRODUCT GUARANTEE, this warranty does not cover damage, disintegration or loss arising from abuse, misuse, vandalism, burns, cuts, punctures, dye transfer, improper installation, use of improper cleaning agents or methods, lack of cleaning, applications of a post treatment, defects in design or abrasion from other furniture components.



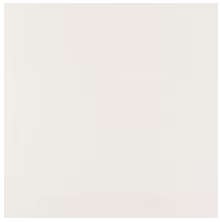

Illusion Full grain PU
80007 Coconut
2002301




Illusion Full grain PU
81105 Blonde
2002302




Illusion Full grain PU
86490 Latte
2002303



Illusion Full grain PU
87241 Taupe
2002304

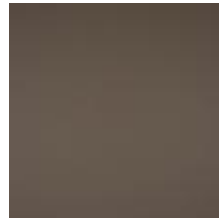

Illusion Full grain PU
46508 Mink
2002305

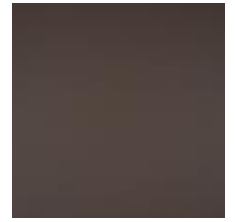

Illusion Full grain PU
47124 Caribou
2002306



Illusion Full grain PU
48013 Chocolat
2002307



Illusion Full grain PU
44388 Dark Camel
2002308




Illusion Full grain PU
23488 Rust
2002309



Illusion Full grain PU
77773 Dark green
2002310




Illusion Full grain PU
76725 Petrol
2002311

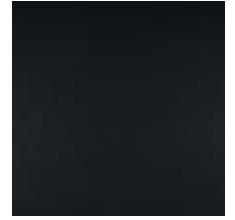

Illusion Full grain PU
68523 Blueberry
2002312



Illusion Full grain PU
57069 Light grey
2002313

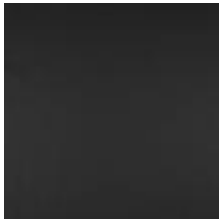

Illusion Full grain PU
59259 Anthracite
2002314



Illusion Full grain PU
00110 Black
2002315